	Approved For Release 2002/06/18 : CIA-RDP74B00836R000300030007-8	1100 - 1000 Normal Composition (Commission Commission ROHING	
	TOPSECRE 1 2 11 3 FORTH	9 10 11	
	5 CC	12 13	
25X1A	DIRECTOR 7 DIEC.	0 15 16	
20/(1/(	ACTION: .	IMMEDIATE	
	TOR: 0512Z 27 APR 64 OSA 1-15	IN 83879 25X1A	
25X1A	NO NITE ACTION  INFO PRIORITY  CITE	25X1A	
25X1A	SUPPLEMENTAL REPORT LOSS OF ARTICLE 382.  1. REVIEW OF ART 382 RECORDS REVEALS FOLLOWING WRITE-UPS WHICH MIGHT HAVE BEARING ON TRIM OF ACFT.  A. 5 MARCH. FULL NOSE-UP TRIM REQUIRED ENTIRE FLIGHT.  CORR ACTION - ADDED 40 POUNDS BALLAST.  B. 18 MARCH. ENGINE FAILURE; AIR FRAME PROBABLY OVERSTRESSED.  CORR ACTION - ACFT DISASSEMBLED AND TRANSPORTED TO FOR		
	TRIM REQUIREMENTS AND RE-RIGGED FLAPS TO CORRECT MINOR CO WHEEL TRIM. ACFT TEST FLOWN AND OK. STALLS CONDUCTED FOR 15 DEGREES, 25 DEGREES, 35 DEGREES AND 50 DEGREES FLAPS. ALSO STALLED WITH 50 DEGREE FLAP ON LANDING TO FURTHER CH	CLEAN, ACFT	

REPRODUCTION BY OTHER THAN THE ISSUING OFFICE IS PROHIBITED. COPY NO.

Approved For Release 2002/06/18: CIA-RDP74B00836R000300030007-8

TOPSECRET

SROUP 1 EXCLUDED FROM AUTO-MATIC DOWNGRADING AND DECLASSIFICATION 25X1A

(IN 83879) TOPSECRET PAGE -2-

CONDITION.

- C. 19 APRIL RIGHT RUDDER NEEDED TO TRIM.

  CORR ACTION BENT TAB 1/16 LEFT.
  - 2. EXAMINATION OF ART 382 AT CRASH SCENE REVEALED THE FOLLOWING:
    - A. AIRCRAFT CONTACTED GROUND IN NORMAL FLIGHT POSITION INTACT.
    - B. GEAR-UP.
    - C. FLAPS UP RETRACTED AND LOCKED.
    - D. DIVE FLAPS EXTENDED.
- E. ALL TRIM TABS ESSENTIALLY IN TRIM (ELEV TAB ACTUATOR BEING CHECKED FOR POSITION).
  - F. EGT INDICATOR STUCK AT 300 DEGREES.
  - G. TURN AND BANK INDICATOR SHOWED FULL LEFT TURN.
  - H. ENGINE ROTATING UNDER POWER AT IMPACT.
- I. AIRCRAFT ALMOST COMPLETELY BURNED FORWARD OF FUSELAGE STATION 465.
  - J. PILOT EJECTED AT LOW ALTITUDE.
  - 3. PILOT REPORTED NO DIFFICULTY PRIOR TO OR AFTER ENTERING SPIN.

    END OF MESSAGE